

Recall Detail

Ref No	10000509
Manufacturer	Brammo
Vehicle Class	Motorcycle
Model/Type	B2
Dealer (phone no)	2624 8899
Subject	Upgrade Oil Breather Baffle
Progress	Running
Affected Vehicle Identification Number (VIN)	List as below:
Description of Defect, how it came to light, and possible consequences if ignored.	<p>Description of defect: If the gearbox is cold (below 10 degrees C), the increase in oil viscosity does not allow oil to properly drain from the breather tube, causing oil to leak out of the breather tube if the gearbox is used at high RPM (before the oil warms up).</p> <p>How it came to light: The issue was first brought to Brammo's attention by a customer. However in this (first) case it was found that the gearbox oil was overfilled by the dealer, and the problem was resolved by a subsequent service. After this, for several months, no other issues arose (as it's related to cold temperatures and it was then summertime). As the winter months came at the end of 2014, we received two additional notices of oil leaking from the gearbox breather tube, and it was then determined that there was an issue.</p> <p>Possible Consequences if ignored: Once the oil leaves the breather tube, it can then be transported by air flow over the moving vehicle to the rear fender and tire. If the oil reaches the rear tire, it could cause a loss of control of the bike.</p>
Remedial Action	For bikes affected by the recall, Brammo will provide a Gearbox Breather Baffle part to be installed by a qualified Dealer or Service Technician. There will be no charge for the part, and the cost of installation will be covered by Brammo.
Build Dates	2013 – 2014 (before 09 July 2014)
Launch Date	02 February 2015
Tentative Date of Recall Completion	15 March 2015

1	51RUB5564DA000019
2	51RUB556XDA000607
3	51RUB5563DA000609
4	51RUB556XDA000624
5	51RUB5567DA000628
6	
7	
8	
9	

10	
11	
12	
13	
14	
15	
16	
17	
18	