Recall Detail		
Ref No	10000583	
Manufacturer	ASTON MARTIN	
Vehicle Class	PRIVATE CAR	
Model/Type	DB9, DBS, Virage, Vanquish	
Dealer (phone no)	MF Jebsen Automotive Limited (2234 0562)	
Subject	Change to the Routing of the Battery Supply Cable	
Progress	Running	
Affected Vehicle Identification Number (VIN)	List as below:	
Description of Defect, how it came to light, and possible consequences if ignored.	It is possible in some circumstances that when the right front seat is operated to its fully rearward position that the seat runner can compress the battery supply cable. If the seat runner repeatedly compresses the cable, damage to the insulation of the cable can occur. When this happens, it is possible that the seat runner can conduct electricity from the battery supply cable. This can make a short circuit which can damage the wiring harness and cause smoke to appear in the passenger compartment.	
Remedial Action	We will install a cable guide onto the battery supply of all affected vehicles. This guide will move the battery supply cable to a different position so that it will not be possible for the seat runner to touch the cable. Also, the condition of the cable will be examined. If damage is found to the battery supply cable, more insulation will be applied to the cable.	
Build Dates	March 2007 - November 2015	
Launch Date	12 April 2016	
Tentative Date of Recall Completion	December 2016	

1	SCFLCCFP2DGJ00075
2	SCFLCCFP2DGJ00139
3	SCFKCCEP9EGJ00525
4	SCFLCCFP1EGJ00554
5	SCFKCCEP7EGJ00555
6	SCFKCCEP2EGJ00561
7	SCFKCCEP4EGJ00562
8	SCFKCCEPXEGJ00565
9	SCFLCCFPXEGJ00701
10	SCFLCCFP6EGJ00713
11	SCFKCCEP6EGJ00756
12	SCFLCCFPXEGJ00780
13	SCFLCCFP8EGJ00776

14	SCFKCCEP3EGJ00813
15	SCFKCCEP3EGJ01251
16	SCFPCCGP5EGK01449
17	SCFPCCGP5EGK01497
18	SCFLLCFU6FGJ01934
19	SCFLLCFUXFGJ02228
20	SCFLLCFU4FGJ02225
21	SCFPLCGU7FGK02416
22	SCFKLCEUXFGJ02422
23	SCFLLCFU3GGJ02606
24	SCFGCCAD3CGE03155
25	SCFGCEAN9CGG13750
26	