

## Recall Detail

<b>Ref No</b>	<b>10000607</b>
<b>Manufacturer</b>	Subaru
<b>Vehicle Class</b>	Private Car
<b>Model/Type</b>	SUBARU BRZ
<b>Dealer (phone no)</b>	Motor Image Kowloon Limited (23936118)
<b>Subject</b>	ECU ASSY EPS harness and shortening EPS harness kit
<b>Progress</b>	<b>Running</b>
<b>Affected Vehicle Identification Number (VIN)</b>	List as below:
<b>Description of Defect, how it came to light, and possible consequences if ignored.</b>	Affected vehicles may experience a possible loss of Electronic Power Steering (EPS) assist during driving. EPS warning light will be turned on when this occurs. This phenomenon is caused by the tin-plating on resolver connector terminal being worn out, leading to occasional loss of contact with the Electronic Control Unit (ECU), which in turn causes a loss of EPS and the EPS warning light to be turned on.
<b>Remedial Action</b>	Replace new ECU ASSY EPS harness and shortening EPS harness kit
<b>Build Dates</b>	2013-2015
<b>Launch Date</b>	24 August 2016
<b>Tentative Date of Recall Completion</b>	31 December 2018

1	JF1ZC6K81DG002106	18	JF1ZC6K72DG003674
2	JF1ZC6K72DG002155	19	JF1ZC6K72DG003684
3	JF1ZC6K81DG002216	20	JF1ZC6K72DG003819
4	JF1ZC6K72DG002237	21	JF1ZC6K72DG003833
5	JF1ZC6K72DG002247	22	JF1ZC6K72DG003836
6	JF1ZC6K81DG002269	23	JF1ZC6K81EG005055
7	JF1ZC6K81DG002293	24	JF1ZC6K81EG005226
8	JF1ZC6K81DG002313	25	JF1ZC6K81EG005671
9	JF1ZC6K81DG002325	26	JF1ZC6K81EG005675
10	JF1ZC6K81DG002326	27	JF1ZC6K81EG005678
11	JF1ZC6K81DG002388	28	JF1ZC6K81FG007098
12	JF1ZC6K72DG002498	29	JF1ZC6K81FG007099
13	JF1ZC6K72DG003518	30	JF1ZC6K81FG007353
14	JF1ZC6K72DG003546	31	JF1ZC6K81FG007356
15	JF1ZC6K72DG003561	32	JF1ZC6K81FG007879
16	JF1ZC6K72DG003574	33	JF1ZC6K81FG007909
17	JF1ZC6K72DG003637		