

Recall Detail

Ref No	10000671
Manufacturer	Mazda Motor Corporation
Vehicle Class	Private Car
Model/Type	Mazda6 (GLK1)
Dealer (phone no)	Vang Iek Motors (Hong Kong) Limited 3768 4848
Subject	Mazda6 SKYACTIV-D 2.2 – Combustion gas leak from injector gasket
Progress	Running
Affected Vehicle Identification Number (VIN)	List as below:
Description of Defect, how it came to light, and possible consequences if ignored.	The tightening torque of the nuts mounting the injector may not be appropriate, which may allow the nuts torque to decrease and the surface pressure of the injector gasket may also decrease. With such condition, the combustion gas may leak through the gasket and allow the gas to come into contact with the engine oil, which may cause the engine oil to carbonize. The carbonized engine oil may pass through the oil line and reach the oil strainer, causing the oil strainer to clog with the carbonized oil, resulting in the engine stall.
Remedial Action	Re-tighten the injector mounting nuts with appropriate torque.
Build Dates	Sep 2013
Launch Date	10 Apr 2017
Tentative Date of Recall Completion	9 Apr 2018

1	JM6GJ1021E0121436
2	JM6GJ1021E0121425
3	JM6GJ1021E0121426
4	JM6GJ1021E0121432
5	JM6GJ1021E0121421