

## Recall Detail

<b>Ref No</b>	<b>10000999</b>
<b>Manufacturer</b>	Honda
<b>Vehicle Class</b>	Private Car
<b>Model/Type</b>	CIVIC TYPE R FK8
<b>Dealer (phone no)</b>	22168183
<b>Subject</b>	Replace of Fuel Pump Kit
<b>Progress</b>	<b>Running</b>
<b>Affected Vehicle Identification Number (VIN)</b>	List as below:
<b>Description of Defect, how it came to light, and possible consequences if ignored.</b>	Affected vehicles may be equipped with a fuel pump module manufactured with low density impellers. If the surface of the lower density impeller is exposed to production solvent drying for longer periods of time, higher levels of surface cracking may occur. These cracks may lead to excessive fuel absorption, resulting in impeller deformation. Over time, if an impeller deforms to a point that creates sufficient interference with the fuel pump body, the fuel pump becomes inoperative, which may cause illumination of the Malfunction Indicator Lamp in the instrument panel. Fuel pump inoperability could prevent an engine from starting or stall an engine while driving, increasing the risk of a crash.
<b>Remedial Action</b>	Replace of Fuel Pump Kit
<b>Build Dates</b>	2018
<b>Launch Date</b>	26 APR 2021
<b>Tentative Date of Recall Completion</b>	26 APR 2028

SHHFK8730JU750158