

## Recall Detail

<b>Ref No</b>	<b>10001000</b>
<b>Manufacturer</b>	Honda
<b>Vehicle Class</b>	Private Car
<b>Model/Type</b>	CIVIC TYPE R FK8
<b>Dealer (phone no)</b>	22168183
<b>Subject</b>	Replace of Fuel Pump Kit
<b>Progress</b>	<b>Running</b>
<b>Affected Vehicle Identification Number (VIN)</b>	List as below:
<b>Description of Defect, how it came to light, and possible consequences if ignored.</b>	Affected vehicles may be equipped with a fuel pump module manufactured with low density impellers. If the surface of the lower density impeller is exposed to production solvent drying for longer periods of time, higher levels of surface cracking may occur. These cracks may lead to excessive fuel absorption, resulting in impeller deformation. Over time, if an impeller deforms to a point that creates sufficient interference with the fuel pump body, the fuel pump becomes inoperative, which may cause illumination of the Malfunction Indicator Lamp in the instrument panel. Fuel pump inoperability could prevent an engine from starting or stall an engine while driving, increasing the risk of a crash.
<b>Remedial Action</b>	Replace of Fuel Pump Kit
<b>Build Dates</b>	2019
<b>Launch Date</b>	26 APR 2021
<b>Tentative Date of Recall Completion</b>	26 APR 2028

SHHFK8730KU750111  
 SHHFK8730KU750102  
 SHHFK8730KU750128  
 SHHFK8730KU750104  
 SHHFK8730KU750109  
 SHHFK8730KU750112  
 SHHFK8730KU750114  
 SHHFK8730KU750115  
 SHHFK8730KU750116  
 SHHFK8730KU750117  
 SHHFK8730KU750126  
 SHHFK8730KU750119  
 SHHFK8730KU750120  
 SHHFK8730KU750121  
 SHHFK8730KU750122

SHHFK8730KU750123  
 SHHFK8730KU750125  
 SHHFK8730KU750118  
 SHHFK8730KU750105  
 SHHFK8730KU750127