

Recall Detail

Ref No	10000537
Manufacturer	Daimler AG
Vehicle Class	Private car
Model/Type	A-Class & CLA-Class / 176 & 117
Dealer (phone no)	Zung Fu Aberdeen Service Centre: 2552 8298 Zung Fu Quarry Bay Service Centre: 2563 4333 Zung Fu Hunghom Service Centre: 2363 9396 Zung Fu Kwai Chung Service Centre: 2427 3355 Zung Fu Yuen Long Service Centre: 2473 3171
Subject	Check fuses (mini fuses) of fuse box in interior on passenger side (8297049)
Progress	Running
Affected Vehicle Identification Number (VIN)	<p>Regarding the chassis number of vehicle affected by this campaign , please refer to EITHER (1) or (2):</p> <p>(1) If vehicle was bought from Zung Fu or ever repaired under warranty in Zung Fu Service Centre, please see below the list of chassis numbers of identified and remaining vehicles.</p> <p>2) If vehicle was not bought from Zung Fu and never repaired under warranty in Zung Fu Service Centre, and the vehicle production date falls into that specified in "Build date", please contact Zung Fu Service Centres at above mentioned telephone numbers, or Mercedes-Benz Hong Kong Limited (Tel: 2594 8800) to clarify whether your vehicle is affect by this recall.</p>
Description of Defect, how it came to light, and possible consequences if ignored.	<p>Individual fuses in the fuse box in the front passenger footwell might not be installed correctly due to deviation in the production process on the part of a supplier.</p> <p>This may lead to the fact that the electrical connection of the respective fuse is interrupted and individual vehicle functions may thus no longer be available due to vibrations that occur in driving operation. In addition to the comfort-relevant features, this includes the seat occupied recognition of the front seats, the status indication of the front passenger airbag, the instrument cluster and the windshield wipers, among others. Activation of the front passenger airbag may not be ensured in case of a relevant accident if the seat occupied recognition of the front seats or the status indication of the front passenger airbag fail. This would increase the risk of injury for the occupants. There would also be an increased accident hazard in case of a failure of the instrument cluster or windshield wipers.</p>
Remedial Action	Check the fuses in the fuse box as a precautionary measure and

	replace the fuse box, if necessary.
Build Dates	A-Class: 07/10/2014 CLA-Class: 09/09/2014 - 25/09/2014
Launch Date	15/07/2015
Tentative Date of Recall Completion	31/12/2015

1	WDD1760442V034175
2	WDD1173442N146297
3	WDD1173442N146837
4	WDD1173442N146920
5	WDD1173442N147111
6	WDD1173442N147237
7	WDD1173442N147421
8	WDD1173442N147482
9	WDD1173522N141335
10	WDD1173522N144759
11	WDD1760442V034075
12	WDD1760442V034115
13	WDD1760442V034219
14	WDD1760442V034372
15	WDD1173432N144051
16	WDD1760442V033732
17	WDD1760442V033870
18	WDD1760442V034009
19	WDD1760442V034703
20	WDD1173442N146270
21	WDD1760442V034110
22	WDD1173432N145666
23	WDD1173432N141530
24	WDD1173432N142046
25	WDD1173432N142429
26	WDD1173432N142450
27	WDD1173432N142454
28	WDD1173432N142519
29	WDD1173432N142814
30	WDD1173432N142815
31	WDD1173432N142981
32	WDD1173432N144286
33	WDD1173432N144737
34	WDD1173432N145168
35	WDD1173442N146224
36	WDD1173432N146145

37	WDD1173442N142784
38	WDD1173442N144582
39	WDD1173442N144809
40	WDD1173442N145172
41	WDD1173442N145240
42	WDD1173442N145342
43	WDD1173442N145540
44	WDD1173442N145661
45	WDD1173442N145732
46	WDD1173442N146089
47	WDD1173432N145079