

Recall Detail

Ref No	10000545
Manufacturer	Daimler AG
Vehicle Class	Private car
Model/Type	E-Class / 212
Dealer (phone no)	Zung Fu Aberdeen Service Centre: 2552 8298 Zung Fu Quarry Bay Service Centre: 2563 4333 Zung Fu Hunghom Service Centre: 2363 9396 Zung Fu Kwai Chung Service Centre: 2427 3355 Zung Fu Yuen Long Service Centre: 2473 3171
Subject	Replace engine compartment seal (6891043)
Progress	Completed
Affected Vehicle Identification Number (VIN)	<p>Regarding the chassis number of vehicle affected by this campaign , please refer to EITHER (1) or (2):</p> <p>(1) If vehicle was bought from Zung Fu or ever repaired under warranty in Zung Fu Service Centre, please see below the list of chassis numbers of identified and remaining vehicles.</p> <p>2) If vehicle was not bought from Zung Fu and never repaired under warranty in Zung Fu Service Centre, and the vehicle production date falls into that specified in "Build date", please contact Zung Fu Service Centres at above mentioned telephone numbers, or Mercedes-Benz Hong Kong Limited (Tel: 2594 8800) to clarify whether your vehicle is affect by this recall.</p>
Description of Defect, how it came to light, and possible consequences if ignored.	<p>A damaged engine compartment seal may have unfortunately been installed on affected vehicle. This could lead to decreased holding abilities on the partition wall. If the engine compartment seal is not secured at the partition wall as intended, it is possible that the seal may partially detach from the partition wall when opening the engine hood due to adhesion to the engine hood.</p> <p>In unfavorable circumstances, a partially detached engine compartment seal may then fall into the gap between the engine and the partition wall. If a long enough part of the engine compartment seal is detached, it cannot be ruled out that the loose end of the engine compartment seal comes in contact with parts of the exhaust system, in particular the catalytic converter. If the catalytic converter is hot enough, a potential fire hazard cannot be ruled out.</p>

Remedial Action	Replace the engine compartment seal on affected vehicles as precautionary measure.
Build Dates	E-Class: 20/04/2015 - 23/04/2015
Launch Date	01/09/2015
Tentative Date of Recall Completion	31/12/2015

1	WDD2120342B192658
2	WDD2120342B192858
3	WDD2120342B192967
4	WDD2122362B190956